# **HS-150T Premium Accelerometer**

AC acceleration and temperature output via 3 Pin MS Connector


# **Key Features**

- Temperature output
- · Customisable features
- · Premium design

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



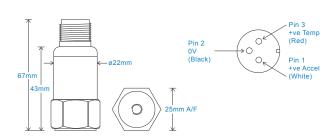

Connection Details

### **Technical Performance**

Mounted Base Resonance see 'How To Order' table (nominal) Sensitivity see: 'How To Order' table ± 10% Nominal 80Hz at 22°C 1.5Hz (90cpm) to 10kHz (600kcpm) ± 5% Frequency Response 0.5Hz (30cpm) to 12kHz (720kcpm) ± 10%  $0.2Hz (12cpm) to 15kHz (900kcpm) \pm 3dB$ Isolation Base isolated see: 'How To Order' table Range Temperature 10 mV/°C standard 100°C - Option 130°C Transverse Sensitivity Less than 5%

### Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Shear
Mounting Torque 8Nm
Weight 140gms (nominal)
Screened Cable Assembly see: www.hansfordsensors.com for options
Connector HS-AA005 - non-booted
HS-AA068 or HS-0069 - booted
Mounting Threads see: 'How To Order' table


# Electrical

# Electrical Noise 0.1mg max Current Range 0.5mA to 8mA Bias Voltage 10 - 12 Volts DC Settling Time 1 second Output Impedance 200 Ohms max. Case Isolation >108 Ohms at 500 Volts

# Environmental

Operating Temperature Range	-55 to 130°C
Sealing	IP68
Maximum Shock	5000g
EMC	EN61326-1:2013

# Typical Frequency Response (at 100mV/g)

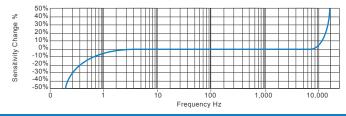


# **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



# How To Order

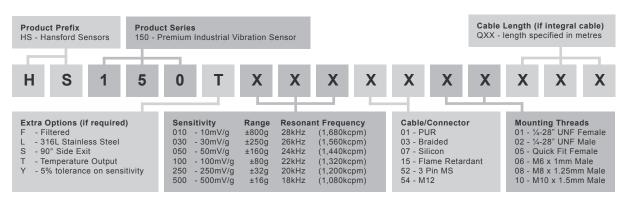



www.hansfordsensors.com sales@hansfordsensors.com

